


INSTALLATION INSTRUCTIONS: 1/2" SUPERFLEXIBLE CONNECTORS




Prep

Install

1  Use CT-CUTTER and insure cable is straight with no bends. For best results, start the blade in a "valley" of the coax. Apply even pressure and rotate the cutter around the cable. This will provide a straight and square cut

1  Install the back o-ring onto the outside copper conductor of the coax until it meets the outer jacket of the coax. Wipe the prepped areas and center conductor of the coax with an alcohol pad to clean.

2  Insert CT-WF12 cable prep tool into a hand drill, and set the drill to medium/high speed. For best results an RPM range of 1,200 to 1,600 is recommended (refer to chart below)

2  Apply grease to the o-ring and screw the back nut onto the cable making sure that the front of the back nut is even with the edge of the outer conductor

3  Start the drill to the recommended speed and with forward pressure, feed the coax into the prep tool, keeping the cable straight and parallel.

3  Slide the front nut onto the cable and attach it to the back nut. Tighten with hand wrenches. Make sure to hold the back nut in place while tightening the front nut.

4  Once the prep tool spins freely on the coax, the cable prep is complete and should look as pictured.

5  Use CT-GATOR to clean the center conductor of any remaining dielectric material.

Always wear proper PPE, including safety glasses and gloves.

RPM Range @ high speed	Popular Hand Drill Models		
	Dewalt	Makita	Milwaukee
12V	0-1,500	0-1,500	0-1,500
18V	0-1,700	0-1,700	0-1,800

Tools Required

- CT-CUTTER
- Drill
- CT-WF38
- CT-GATOR
- Alcohol Pad
- Wrenches
- Safety Glasses

